



**Citroën C3**  
Standard Safety Equipment

2017 ★★★★★



Adult Occupant



Child Occupant



Pedestrian Impact Protection



Safety Assist



SPECIFICATION

Tested Model	Citroën C3 1,2 PureTech 82 FEEL, LHD
Body Type	- 5 door hatchback
Year Of Publication	2017
Kerb Weight	1072kg
VIN From Which Rating Applies	- all C3s
Class	Supermini

SAFETY EQUIPMENT

	Driver	Passenger	Rear
<b>FRONTAL CRASH PROTECTION</b>			
Frontal airbag	●	●	✘
Belt pretensioner	●	●	●
Belt loadlimiter	●	●	●
Knee airbag	✘	✘	✘
<b>SIDE CRASH PROTECTION</b>			
Side head airbag	●	●	●
Side chest airbag	●	●	✘
Side pelvis airbag	✘	✘	✘

Version 300419

## SAFETY EQUIPMENT (NEXT)

	Driver	Passenger	Rear
CHILD PROTECTION			
Isofix	—	○	●
Integrated CRS	—	✗	✗
Airbag cut-off switch	—	●	—
SAFETY ASSIST			
Seat Belt Reminder	●	●	●

OTHER SYSTEMS	
Active Bonnet (Hood)	✗
AEB Pedestrian	✗
AEB City	✗
AEB Inter-Urban	✗
Speed Assistance System	●
Lane Assist System	●

**Note: Other equipment may be available on the vehicle but was not considered in the test year.**

- Fitted to the vehicle as standard   
 ○ Fitted to the vehicle as part of the safety pack  
○ Not fitted to the test vehicle but available as option or as part of the safety pack   
 ✗ Not available   
 — Not applicable

**ADULT OCCUPANT**

Total 33.5 Pts / 88%

■ GOOD   
 ■ ADEQUATE   
 ■ MARGINAL   
 ■ WEAK   
 ■ POOR

**Frontal Offset Deformable Barrier** 7.5 Pts




Passenger                      Driver

**Frontal Full Width** 7.5 Pts




Rear Passenger                      Driver

**Whiplash Rear Impact** 2.7 Pts



Front seat                      Rear seat

**Lateral Impact** 15.8 Pts



Car                      Pole


**AEB City** 0


Performance:

 ADULT OCCUPANT

Total 33.5 Pts / 88%

 GOOD

 ADEQUATE

 MARGINAL

 WEAK

 POOR

 ADULT OCCUPANT

Total 33.5 Pts / 88%

## Comments

The passenger compartment of the C3 remained stable in the frontal offset test. Dummy readings indicated good protection of the knees and femurs for the driver and passenger. Citroën showed that a similar level of protection would be provided to occupants of different sizes and to those sat in different seating positions. In the full-width rigid barrier test, protection of the chest and neck was adequate for the driver and rear passenger, and that of other critical body areas was good. The C3 scored maximum points for its performance in the side barrier test, with good protection of all critical parts of the body. Even in the more severe side pole impact, protection of the chest was adequate and that of other body regions was good. Tests on the front seats and head restraints demonstrated good protection against whiplash injury in the event of a rear-end collision, and a geometric assessment of the rear seats showed good protection there, too. The C3 does not have an autonomous emergency braking system.

**CHILD OCCUPANT**

Total 41.0 Pts / 83%

■ GOOD   
 ■ ADEQUATE   
 ■ MARGINAL   
 ■ WEAK   
 ■ POOR

Crash Test Performance based on 6 & 10 year old children

22 Pts

Frontal Impact 14 Pts



Lateral Impact 8 Pts



Restraint for 6 year old child: *ROMER Kidfix XP*  
 Restraint for 10 year old child: *GRACO booster*

Safety Features

7 Pts

	Front Passenger	2nd row outboard	2nd row center
Isofix	✗	●	✗
i-Size	✗	●	✗
Integrated CRS	✗	✗	✗

● Fitted to test car as standard   
 ○ Not on test car but available as option   
 ✗ Not available

CRS Installation Check

12 Pts

● Install without problem   
 ● Install with care   
 ● Safety critical problem   
 ✗ Installation not allowed

■ i-Size CRS

Maxi Cosi 2way Pearl & 2wayFix (rearward) (iSize)



Maxi Cosi 2way Pearl & 2wayFix (forward) (iSize)



BeSafe iZi Kid X2 i-Size (iSize)



**CHILD OCCUPANT**

Total 41.0 Pts / 83%

**ISOFIX CRS**

Maxi Cosi Cabriofix & FamilyFix (ISOFIX)



BeSafe iZi Kid X4 ISOfix (ISOFIX)



Britax Römer Duo Plus (ISOFIX)



Britax Römer KidFix XP (ISOFIX)



**Universal Belted CRS**

Maxi Cosi Cabriofix (Belt)



Maxi Cosi Cabriofix & EasyBase2 (Belt)



Britax Römer King II LS (Belt)



Britax Römer KidFix XP (Belt)



## CHILD OCCUPANT

Total 41.0 Pts / 83%

	Seat Position			
	Front	2nd row		
	PASSENGER	LEFT	CENTER	RIGHT
Maxi Cosi 2way Pearl & 2wayFix (rearward) (iSize)	□	●	□	●
Maxi Cosi 2way Pearl & 2wayFix (forward) (iSize)	□	●	□	●
BeSafe iZi Kid X2 i-Size (iSize)	□	●	□	●
Maxi Cosi Cabriofix & FamilyFix (ISOFIX)	□	●	□	●
BeSafe iZi Kid X4 ISOfix (ISOFIX)	□	●	□	●
Britax Römer Duo Plus (ISOFIX)	□	●	□	●
Britax Römer KidFix XP (ISOFIX)	□	●	□	●
Maxi Cosi Cabriofix (Belt)	●	●	●	●
Maxi Cosi Cabriofix & EasyBase2 (Belt)	●	●	✘	●
Britax Römer King II LS (Belt)	●	●	●	●
Britax Römer KidFix XP (Belt)	●	●	●	●

● Install without problem  
 ● Install with care  
 ● Safety critical problem  
 ✘ Installation not allowed

## Comments

In the frontal offset test, readings of neck tension in the 10 year dummy, and of chest deceleration in the 6 year dummy indicated a marginal level of protection. Otherwise, protection was adequate or good. In the side barrier test, protection was good for all critical parts of the body. The front passenger airbag can be disabled to allow a rearward-facing child restraint to be used in that seating position. Clear information is provided to the driver and the system was rewarded. All of the restraint types for which the C3 is designed could be properly installed and accommodated in the car.




PEDESTRIAN IMPACT PROTECTION

Total 25.0 Pts / 59%

■ GOOD   
 ■ ADEQUATE   
 ■ MARGINAL   
 ■ WEAK   
 ■ POOR

Pedestrian Impact Protection 25 Pts

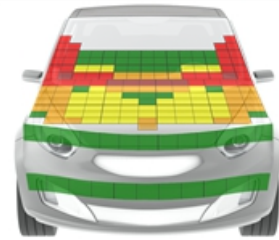

Head Impact	13 Pts
Pelvis Impact	6 Pts
Leg Impact	6 Pts

AEB Pedestrian 0 Pts

**Comments**

The protection offered by the bonnet to the head of a struck pedestrian was predominantly adequate. Poor results were recorded around the base of the windscreen and on the stiff windscreen pillars. The protection offered to the pelvis and to the legs were good, with maximum points scored in these areas of assessment.

SAFETY ASSIST

Total 7 Pts / 58%

■ GOOD   
 ■ ADEQUATE   
 ■ MARGINAL   
 ■ WEAK   
 ■ POOR

Speed Assistance

2.5 Pts

System Name	Speed Limit Recognition and Recommendation
Speed Limit Information Function	Camera based, subsigns supported
Warning Function	System advised
Speed Limitation Function	System advised (accurate to 5km/h)

Seat Belt Reminder

3 Pts

Applies To	All seats		
	Driver Seat	front passenger(s)	rear passenger(s)
Warning			
Visual	●	●	●
Audible	●	●	●

● Pass   
 ● Fail   
 — Not available

Lane Support

1.5 Pts

System Name	Lane Departure Warning
Type	Lane Departure Warning
Operational From	70 km/h
Warning	Audible and Visual
PERFORMANCE	
LDW Confirmation Test	Pass

AEB Interurban

0 Pts



## SAFETY ASSIST

Total 7 Pts / 58%

## Comments

A seatbelt reminder system for the front and rear seats is standard on the C3. The speed assistance system uses a camera to detect what the limit is and informs the driver, who can then manually set the appropriate speed for the limiter. A lane assistance system is also standard equipment and warns the driver if the car is drifting out of lane.

## RATING VALIDITY

## Annual Reviews and Facelifts

Date	Event	Outcome
March 2017	Rating Published	2017  