


Renault Mégane Small Family Car



2015 <  $\star$   $\star$   $\star$   $\star$ 



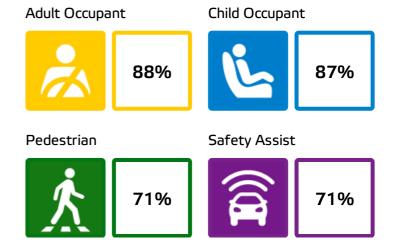

## SPECIFICATION

Tested Model	Renault Mégane 1.5dCi, LHD
Body Type	- 5 door hatchback
Year Of Publication	2015
Kerb Weight	1318kg
VIN From Which Rating Applies	- all Méganes, including Mégane Sedan
Class	Small Family Car

X Rating Expired



## SAFETY EQUIPMENT

	Driver	Passenger	Rear
FRONTAL CRASH PROTECTION			
Frontal airbag	•	•	—
Belt pretensioner	•	•	•
Belt loadlimiter	•	•	٠
Knee airbag	×	×	_
SIDE CRASH PROTECTION			
Side head airbag	•	•	٠
Side chest airbag	•		×
Side pelvis airbag	×	×	×

Euro NCAP © Renault Mégane Dec 2015 2/13



## SAFETY EQUIPMENT (NEXT)

	Driver	Passenger	Rear
CHILD PROTECTION			
Isofix		×	٠
Integrated CRS		×	×
Airbag cut-off switch			
SAFETY ASSIST			
Seat Belt Reminder	•		٠


OTHER SYSTEMS	
Active Bonnet (Hood)	×
ESC	•
AEB City	×
AEB Inter-Urban	0
Speed Assistance System	0
Lane Assist System	0


Note: Other equipment may be available on the vehicle but was not considered in the test year.

Fitted to the vehicle as option


- Fitted to the vehicle as standard
- 🚫 Not fitted to the test vehicle but available as option 🛛 🗙 Not Available 🛛 Not Applicable



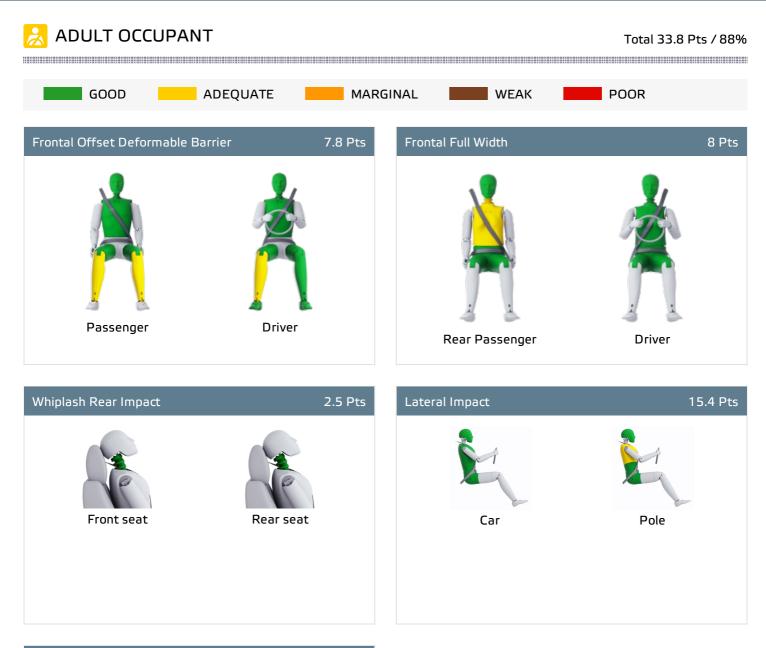

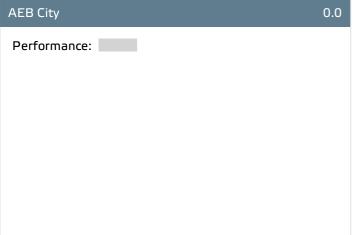


Euro NCAP © Renault Mégane Dec 2015 4/13

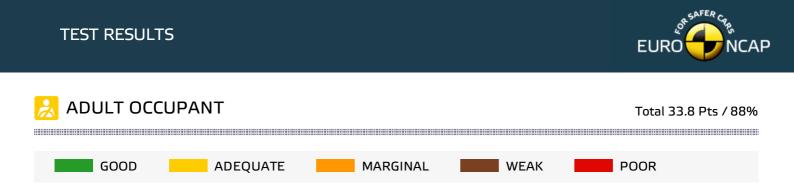

Euro NCAP © Renault Mégane Dec 2015 5/13






Total 33.8 Pts / 88%

#### Comments

The passenger compartment of the Mégane remained stabled in the frontal impact. Dummy readings indicated good protection of the knees and femurs of the driver and passenger. Renault showed that a similar level of protection would be provided to occupants of different sizes and those sat in different positions. In the side barrier impact, protection was good for all body critical body regions, and the car scored maximum points. In the more severe side pole test, protection of the chest was rated as adequate, with good protection of other parts of the body. In Euro NCAP's tests, the front seats and head restraints demonstrated good protection against whiplash injury in the event of a rear-end collision. A geometric assessment of the rear seats indicated good protection also for occupants of those seats. A low-speed autonomous emergency braking system is not available on the Mégane.



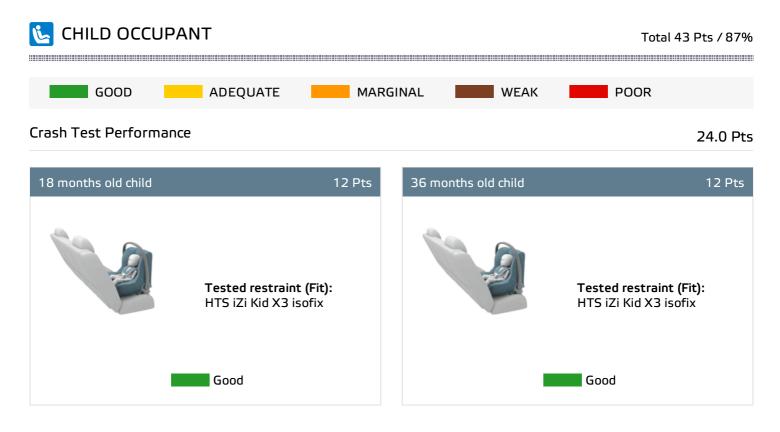

### Safety Features

7.0 Pts

		Front Passenger	2nd row outboard	2nd row center
	Isofix	×		×
	i-Size	×	•	×
	Integrated CRS	×	×	×
Fitted to test car as standard (	Not on test car but available as option 🛛 🗙	Not available		
CRS Installation Check				12.0 Pt
Install without problem	all with care 😑 Safety critical problem	🗙 Installation r	not allowed	
Infants up to 13 kg				
Maxi Cosi Cabriofix (Belt)	Maxi Cosi Cabriofix & EasyFix (Belt)	Maxi Cosi (	Cabriofix & Easy	Fix (ISOFIX)
			X	A A A





Total 43 Pts / 87%


#### Infants and toddlers up to 18 kg



#### Toddlers from 9 to 18 kg



### Toddlers over 18 kg

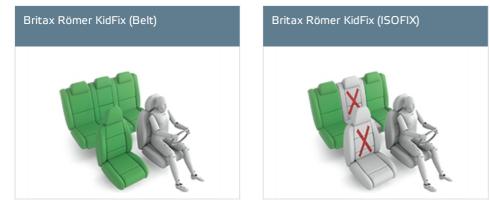





Total 43 Pts / 87%


		Seat Position			
	Front		2nd row		
	PASSENGER	LEFT	CENTER	RIGHT	
Maxi Cosi Cabriofix (Belt)	•	•	•	•	
Britax Römer King Plus (Belt)	•	•	•		
Britax Römer Duo Plus (ISOFIX)	*		×		
Britax Römer KidFix (Belt)	•		•		
Maxi Cosi Cabriofix & EasyFix (Belt)	•		×		
Maxi Cosi Cabriofix & EasyFix (ISOFIX)	×		×		
BeSafe iZi Kid X3 ISOfix (ISOFIX)	×		×		
Maxi Cosi Pearl & Familyfix (ISOFIX)	×		×	•	
Britax Römer KidFix (ISOFIX)	×		×		

Not available

#### Comments


The Mégane scored full points for its protection of both the 11/2 year dummy and the 3 year dummy in the full scale crash tests. Both were seated in rearward-facing restraints. In the side barrier test, both dummies were properly contained within the protective shells of their restraints, minimising the risk of contact with parts of the vehicle interior. The front passenger airbag can be disabled to allow a rearwardfacing child restraint to be used in that seating position. Clear information is provided to the driver about the status of the airbag and the system was rewarded. All of the restraint types for which the Mégane is designed could be correctly installed and accommodated in the car.



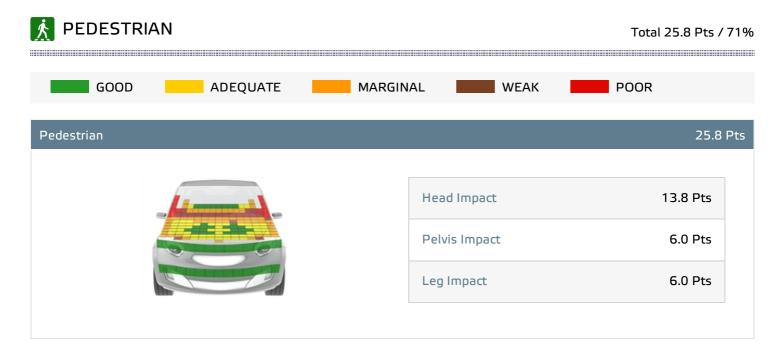

#### Comments

The bumper scored maximum points for its protection of pedestrians' legs, with good results at all test points. Likewise, the Mégane provided good protection to the pelvic region of a struck pedestrian. The protection provided by the bonnet to the head of a struck pedestrian was predominantly good or adequate, with poor results recorded only on the stiff windscreen pillars.

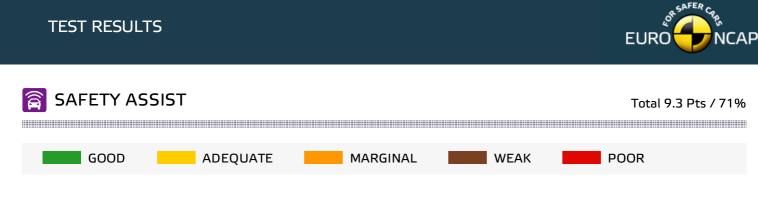

### Speed Assistance

System Name	Traffic Sign Recognition
Speed Limit Information Function	Camera based
Warning Function	System advised
Speed Limitation Function	System advised

### Electronic Stability Control

System Name	ESP	
PERFORMANCE		
Vehicle Yaw Rate @ COS + 1.00 s	2.6%	meets ECE requirements
Vehicle Yaw Rate @ COS + 1.75 s	2.2%	meets ECE requirements
Lateral Displacement @ BOS + 1.07 s	3.3 m	meets ECE requirements

### Seatbelt Reminder

3.0 Pts

2.3 Pts

3 Pts

Applies To	All seats		
Warning	Driver Seat	Front Passenger(s)	Rear Passenger(s)
Visual	•	•	•
Audible	•	•	•

Pass 🔴 Fail — Not available

## Lane Support

Туре	Lane Departure Warning
Operational From	70 km/h
Warning	Audible & Visual
PERFORMANCE	
LDW Confirmation Test	Pass
	Operational From Warning PERFORMANCE

System Name Lane Departure Warning



## 🛜 SAFETY ASSIST

Total 9.3 Pts / 71%

#### Comments

Electronic stability control is standard equipment on the Mégane, together with a seatbelt reminder that protects the front and rear seats. Autonomous emergency braking is available as an option but is not expected to be sold in sufficient numbers to qualify for assessment by Euro NCAP. A speed assistance system is an option that is expected to be broadly fitted. It uses an onboard camera to determine the speed limit at any point. This information is provided to the driver who can choose to let the system limit the car's speed as appropriate. A lane departure warning system is also available as an option on the Mégane and was rewarded in this assessment.



## RATING VALIDITY

# Variants of Model Range

### Annual Reviews and Facelifts

Date	Event	Outcome	
December 2015	Rating Published	2015 ★ ★ ★ ★	~
December 2016	Annual Review	2015 🚖 🚖 🚖 🚖	~
December 2017	Annual Review	2015 🚖 🚖 🚖 🚖	✓
December 2018	Facelift Review	2015 🚖 🚖 🚖 🚖	✓
December 2019	Annual Review	2015 🚖 🚖 🚖 🚖	✓
December 2020	Facelift Review	2015 🌟 🜟 🜟 🌟	✓
December 2021	Annual Review	2015 🚖 🚖 🚖 🚖	✓
January 2022	Rating Expired	2015 🚖 🚖 🚖 🚖	×