



Kia Niro
Standard Safety Equipment

2016



Adult Occupant



83%

Child Occupant



80%

Pedestrian



57%

Safety Assist



59%

SPECIFICATION

Tested Model	Kia Niro GL, 1.6GDI Hybrid, LHD
Body Type	- 5 door hatchback
Year Of Publication	2016
Kerb Weight	1414kg
VIN From Which Rating Applies	- all Kia Niros including PHEVs
Class	Small Family Car

✗ Rating Expired

SAFETY EQUIPMENT

	Driver	Passenger	Rear
FRONTAL CRASH PROTECTION			
Frontal airbag	●	●	✘
Belt pretensioner	●	●	●
Belt loadlimiter	●	●	●
Knee airbag	●	✘	✘
SIDE CRASH PROTECTION			
Side head airbag	●	●	●
Side chest airbag	●	●	✘
Side pelvis airbag	●	●	✘

SAFETY EQUIPMENT (NEXT)

	Driver	Passenger	Rear
CHILD PROTECTION			
Isofix/i-Size	—	✘	●
Integrated CRS	—	✘	✘
Airbag cut-off switch	—	●	—
SAFETY ASSIST			
Seat Belt Reminder	●	●	●

OTHER SYSTEMS	
Active Bonnet (Hood)	✘
AEB Pedestrian	○
AEB City	○
AEB Inter-Urban	○
Speed Assistance System	●
Lane Assist System	●

Note: Other equipment may be available on the vehicle but was not considered in the test year.

- Fitted to the vehicle as standard
 ○ Fitted to the vehicle as part of the safety pack
○ Not fitted to the test vehicle but available as option or as part of the safety pack
 ✘ Not available
 — Not applicable

ADULT OCCUPANT

Total 31.8 Pts / 83%

■ GOOD
 ■ ADEQUATE
 ■ MARGINAL
 ■ WEAK
 ■ POOR

Frontal Offset Deformable Barrier 7.1 Pts

Passenger Driver

Frontal Full Width 6.3 Pts

Rear Passenger Driver

Whiplash Rear Impact 2.5 Pts

Front seat Rear seat

Lateral Impact 16.0 Pts

Car Pole

AEB City 0.0

Performance:



ADULT OCCUPANT

Total 31.8 Pts / 83%



GOOD



ADEQUATE



MARGINAL



WEAK



POOR

 ADULT OCCUPANT

Total 31.8 Pts / 83%

Comments

The passenger compartment remained stable in the frontal offset test. Dummy readings indicated good protection of the knees and femurs of the driver and passenger. Kia showed that a similar level of protection would be provided to occupants of different sizes and to those sat in different positions. In the full-width frontal impact, protection of the driver was good or adequate. However, protection of the rear seat occupant was rated as weak for the chest and poor for the pelvis. Dummy readings indicated that the pelvis had slipped under the seatbelt instead of being properly restrained by it. In the side barrier and more severe side pole impact, the Niro scored maximum points, with good protection of all critical body areas. Tests showed good protection from the front seats and head restraints against whiplash injuries in the event of a rear-end collision. A geometric assessment of the rear seats indicated marginal protection. Additional whiplash protection is available from the 'Advanced Driving Assistance Pack', available as an option and not included in this assessment.



CHILD OCCUPANT

Total 39.6 Pts / 80%

■ GOOD
 ■ ADEQUATE
 ■ MARGINAL
 ■ WEAK
 ■ POOR

Crash Test Performance based on 6 & 10 year old children

21.1 Pts

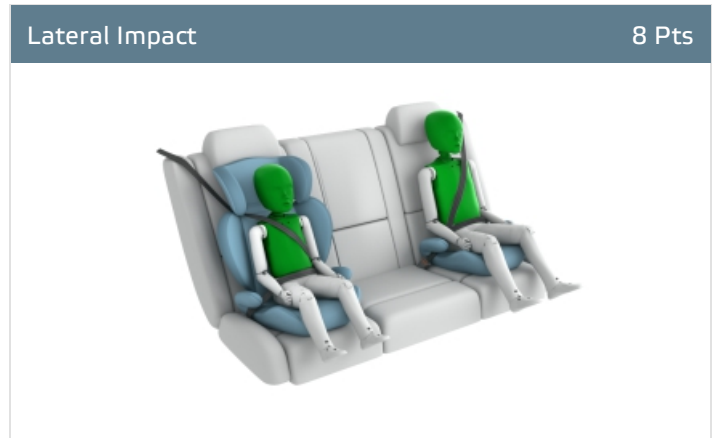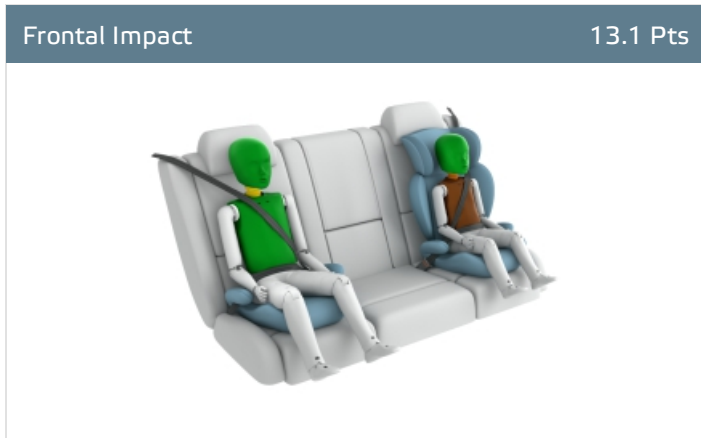

Restraint for 6 year old child: *Britax Römer Kidfix XP II*
 Restraint for 10 year old child: *Graco Junior III*

Safety Features

7.0 Pts

	Front Passenger	2nd row outboard	2nd row center
Isofix	✘	●	✘
i-Size	✘	●	✘
Integrated CRS	✘	✘	✘

● Fitted to test car as standard
 ○ Not on test car but available as option
 ✘ Not available

CRS Installation Check

11.5 Pts

- Install without problem
- Install with care
- Safety critical problem
- ✗ Installation not allowed

■ i-Size CRS

Maxi Cosi 2way Pearl & 2wayFix (rearward) (iSize)



Maxi Cosi 2way Pearl & 2wayFix (forward) (iSize)



BeSafe iZi Kid X1 i-Size (iSize)



■ ISOFIX CRS

Maxi Cosi Cabriofix & FamilyFix (ISOFIX)



BeSafe iZi Kid X3 ISOfix (ISOFIX)




Britax Römer Duo Plus (ISOFIX)



Britax Römer KidFix XP (ISOFIX)



 CHILD OCCUPANT

Total 39.6 Pts / 80%

■ Universal Belted CRS

Maxi Cosi Cabriofix (Belt)



Maxi Cosi Cabriofix & EasyBase2 (Belt)



Britax Römer King II LS (Belt)



Britax Römer KidFix XP (Belt)



CHILD OCCUPANT

Total 39.6 Pts / 80%

	Seat Position			
	Front	2nd row		
	PASSENGER	LEFT	CENTER	RIGHT
Maxi Cosi 2way Pearl & 2wayFix (rearward) (iSize)	—	●	—	●
Maxi Cosi 2way Pearl & 2wayFix (forward) (iSize)	—	●	—	●
BeSafe iZi Kid X1 i-Size (iSize)	—	●	—	●
Maxi Cosi Cabriofix & FamilyFix (ISOFIX)	—	●	—	●
BeSafe iZi Kid X3 ISOfix (ISOFIX)	—	●	—	●
Britax Römer Duo Plus (ISOFIX)	—	●	—	●
Britax Römer KidFix XP (ISOFIX)	—	●	—	●
Maxi Cosi Cabriofix (Belt)	●	●	●	●
Maxi Cosi Cabriofix & EasyBase2 (Belt)	●	●	●	●
Britax Römer King II LS (Belt)	●	●	●	●
Britax Römer KidFix XP (Belt)	●	●	●	●

● Install without problem
 ● Install with care
 ● Safety critical problem
 ✘ Installation not allowed

— Not available

Comments

In the frontal test, protection of the 10 year dummy was good apart from the neck, protection of which was adequate. Readings from the 6 year dummy indicated weak chest protection and a marginal level of neck protection. In the side impact, protection of both child dummies was good and the Niro scored maximum points. The front passenger airbag can be disabled to allow a rearward-facing child restraint to be used in that seating position. Clear information is provided to the driver regarding the status of the airbag and the system was rewarded. All of the child restraints for which the Niro is designed could be properly installed and accommodated apart from the Universal Group I and Group II/III restraints in the rear centre seat.

PEDESTRIAN

Total 24.3 Pts / 57%

■ GOOD
 ■ ADEQUATE
 ■ MARGINAL
 ■ WEAK
 ■ POOR

Pedestrian	24.3 Pts						
	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="padding: 5px;">Head Impact</td> <td style="text-align: right; padding: 5px;">13.9 Pts</td> </tr> <tr> <td style="padding: 5px;">Pelvis Impact</td> <td style="text-align: right; padding: 5px;">4.4 Pts</td> </tr> <tr> <td style="padding: 5px;">Leg Impact</td> <td style="text-align: right; padding: 5px;">6.0 Pts</td> </tr> </table>	Head Impact	13.9 Pts	Pelvis Impact	4.4 Pts	Leg Impact	6.0 Pts
Head Impact	13.9 Pts						
Pelvis Impact	4.4 Pts						
Leg Impact	6.0 Pts						

AEB Pedestrian	0.0 Pts
----------------	---------

Comments

The bonnet provided predominantly good or adequate protection against head injuries, with poor results recorded along the edges and on the stiff windscreen pillars. The bumper provided good protection to pedestrians' legs at all test points. Protection of the pelvis was mostly good, although poor results were recorded at the outer edges. The 'Advanced Driving Assistance Pack' includes an autonomous emergency braking system which can detect pedestrians. The results of those tests are not included in this assessment as the pack is an option.

SAFETY ASSIST

Total 7.1 Pts / 59%

GOOD
 ADEQUATE
 MARGINAL
 WEAK
 POOR

Speed Assistance

1.5 Pts

System Name	Speed Limiter
Speed Limit Information Function	N/A
Warning Function	Manually set
Speed Limitation Function	Manually set (accurate to 5km/h)

Seatbelt Reminder

3.0 Pts

Applies To	All seats		
	Driver Seat	Front Passenger(s)	Rear Passenger(s)
Warning			
Visual	●	●	●
Audible	●	●	●

● Pass
 ● Fail
 — Not available

Lane Support

2.6 Pts

System Name	Lane Keep Assist
Type	Lane Keep Assist and Lane Departure Warning
Operational From	55 km/h
Warning	Audible
PERFORMANCE	
LKA Confirmation Test	Pass (5/5)
LDW Confirmation Test	Pass

AEB Inter-Urban

0 Pts



SAFETY ASSIST

Total 7.1 Pts / 59%

Comments

The Niro has a standard seatbelt reminder for the front and rear seats. A driver-set speed limiter is also standard, together with a lane assistance system that warns the driver when the car is drifting out of lane and gently steers the car away from the lane marker. Autonomous emergency braking is part of the option pack and is not included here.

RATING VALIDITY

Variants of Model Range

Annual Reviews and Facelifts

Date	Event	Outcome
August 2016	Rating Published	2016 ★ ★ ★ ★ ☆
August 2017	Annual Review	2016 ★ ★ ★ ★ ☆
August 2018	Annual Review	2016 ★ ★ ★ ★ ☆
June 2019	Facelift Review	2016 ★ ★ ★ ★ ☆
August 2019	Annual Review	2016 ★ ★ ★ ★ ☆
August 2020	Annual Review	2016 ★ ★ ★ ★ ☆
August 2021	Annual Review	2016 ★ ★ ★ ★ ☆